

Nymi Connected Worker Platform Release Notes

CWP 1.15.0

2024-February-05 v1.0



Contents

Contents	2
Table 1: Revision History	3
Nymi Connected Worker Platform 1.15.0	4
Nymi Connected Worker Platform components	4
Nymi Documentation Package	4
NFC Reader Support	5
New In This Release	5
Tap-to-Authenticate Performance Improvements	5
Backwards Compatibility	6
Table 2: Backwards Compatibility Table	6
Upgrading to the Present Release	7
Table 3: Upgradability Table	7
Known Issues and Limitations	8
Table 4: Resolved Issues in CWP 1.15.0	8
Table 5: Known Issues in CWP 1.15.0	8
Table 6: Resolved Issues in CWP 1.14.2	8
Table 7: Known Issues in CWP 1.14.2	9
Table 8: Known Issues in CWP 1.14.1	9
Table 9: Resolved Issues in CWP 1.14.1	10
Table 10: Resolved Issues in CWP 1.14.0	10
Table 11: Known Issues in CWP 1.13.0	10
Table 12: Known Issues in CWP 1.9.0	10
Table 13: Known Issues in CWP 1.7.0	11
Table 14: Resolved Issues in CWP 1.6.1	11
Table 15: Known Issues in CWP 1.6.1	11
Table 16: Resolved Issues in CWP 1.3.6	12



Table 17: Resolved Issues in CWP 1.3.4	12
Table 18: Known Issues in CWP 1.3.3	12
Table 19: Resolved Issues in CWP 1.3.3	13
Table 20: Known Issues in CWP 1.3.1	13
Table 21: Known Issues in CWP 1.3	13
Table 22: Known Issues in CWP 1.2.1	14
Table 23: Known Issues in CWP 1.2.0	14
Table 24: Known Issues in CWP 1.1.x	16
Table 25: Known Issues in NEE 3.3.0	21
Table 26: Known Issues for NEE 3.2.1	21

Table 1: Revision History

Version	Date	Revision History
1	February 05, 2024	First release of document



Nymi Connected Worker Platform 1.15.0

Nymi's Connected Worker Platform (CWP) connects people with technology through safe, simple, and secure solutions. The Connected Worker Platform supports numerous use cases and digital systems and combines point solutions into a single offering.

The goal of the Connected Worker Platform is to simplify the connection of workers to the digital space found in modern organizations. When the barriers to secure digital work are removed, workers can focus on what they do best.

The CWP 1.15.0 is a minor release with Risk Level 0. It can be used for use in production deployments or GxP environments.

Nymi Connected Worker Platform components

CWP 1.15.0 includes the following component versions:

- Nymi Band™ 3.0
- Firmware version of Nymi Band 3.0 4.10.1.22
- Nymi Band Application 5.4.0.20
- Nymi Lock Control 3.5.0.20
- Nymi Enterprise Server 5.4.0.6
- Nymi Enterprise Server Auto Deployment Scripts 1.9.4
- Nymi SDK 5.20.0.18
- Nymi iOS package 0.4.4

Nymi Documentation Package

Documentation has been updated in CWP 1.15.0. For latest documentations visit the Nymi Support site.

- To access all the core documents, visit: https://support.nymi.com/hc/en-us/sections/360004058491-Release-Documentation
- To access all the secondary documents, visit: https://support.nymi.com/hc/en-us/sections/360012100892-Supplementary-Product-Documentation



NFC Reader Support

NFC readers were not explicitly tested under the present release. For a list of NFC readers supported in this release, please refer to the **Supported NFC Readers** document.

New In This Release

Tap-to-Authenticate Performance Improvements

Tap-to-Auth speed is a key metric in CWP's value proposition. The performance can be affected by how the solution is deployed. For instance, any de-centralized deployments with high network latency see a slow down in tap-to-authenticate speed. In this release, two key operations behind the tap-to-authenticate operation are redesigned. The improvement reduces the number of roundtrips between the Nymi SDK and Nymi Band while maintaining a high level of security. As a secondary benefit, there is no longer a need for NEAs to periodically retrieve certificates from NES, eliminating potential failure points in runtime.



Backwards Compatibility

Table 2: Backwards Compatibility Table

Legend:

• Compatible, fully verified ○ Expect to be compatible, not verified □ Not compatible (empty box)

											(CIII)	iy box	• /
				Nymi Infrastructure									
			NEE	NEE	CWP	CWP		CWP		CWP			
		1	3.2	3.3	1.2.x	1.3.x	1.6.x	1.7.0	1.8.1	1.9.0	1.13.0	1.14.0	1.15.0
		NEE 3.2	•	•									
		NEE 3.3	•	•									
ڻ ن		CWP 1.2.x			•	•							
war		CWP 1.3.x			•	•	•1				•	•	•
Nymi Band Firmware	3.0	CWP 1.6.x				•	•1	•	•		0	0	0
Jd F	Nymi Band	CWP 1.7.0					•	•	•	•	•	•	•
Bar	Nyn	CWP 1.8.1					•	•	•	•	0	0	0
ymi		CWP 1.9.0						•	•	•	0	0	0
Ž		CWP1.13.0									•2	•	0
		CWP1.14.0									•	•	0
		CWP1.15.0											•

^{1.} The NBA in CWP 1.6 requires the Firmware in CWP 1.6. The NBA in CWP 1.3 will be tested with CWP 1.6 to allow for customers with a mixture of firmware.

^{2.} CWP1.13.0 (and CWP1.12.2) introduced breaking changes that prevent Nymi Band firmware to properly work with Nymi infrastructure CWP1.9.0 and below. The Nymi Band must be re-enrolled with CWP1.13 and above infrastructure.



Upgrading to the Present Release

Table 3: Upgradability Table

FROM	ТО	Order of Upgrade
NEE 3.2.X NEE 3.3.X ³		 Evidian (if applicable) NES, NBA, and LC must be upgraded together SDK Firmware: enrolled Nymi Band requires re-enrolling after upgrade
CWP 1.1.X CWP 1.2.X CWP 1.3.X CWP 1.5.X	CWP 1.15.0	 Evidian (if applicable) NES, NBA, and LC must be upgraded together SDK Firmware (NBA: requires the firmware of CWP 1.6.x and above)
CWP1.6.X and above		 Evidian (if applicable) NES, NBA, and LC must be upgraded together SDK Firmware

^{3.} The change implemented in CWP prevents Nymi Band running CWP 1.3.0 firmware and above to work properly with NEE 3.3.x SDK, specifically the Nymi Bluetooth Endpoint. To ensure the CWP function as expected, all CWP components must be upgrade.



Known Issues and Limitations

Table 4: Resolved Issues in CWP 1.15.0

Issue Number	Description
NF-4049	Issue: Nymi Band advertise incorrect presence status
SDK5-2741	Issue: SDK Installer stability issues

Table 5: Known Issues in CWP 1.15.0

Issue Number	Description
SDK5-2541	Issue: Nymi Bluetooth Endpoint connection to centralized Nymi Agent can fail when the terminal's network connection changes.
SDK5-2863	Issue: NES basic authentication through webapi does not use the certificates in the Windows certificate store.
SDK5-2874	Issue: When the CWP is configured to not use NEA certificates, a few operations require secure session with Nymi Band can be blocked.

Table 6: Resolved Issues in CWP 1.14.2

Issue Number	Description
NEM-3009 NEM-3052	Issue: Users who belong to lots of Active Directory Groups (AD) or groups with long group names can experience slow response in Evidian, Evidian crashing, or NES admin console authentication failures.
SDK5-2730	Issue: Nymi Runtime installation can fail in non-English operating systems.
SDK5-2657	Issue: Nymi Runtime installation stability issue where an installation can fail



Table 7: Known Issues in CWP 1.14.2

Issue Number	Description
CWP-2750	Issue: Updating firmware from a version below 4.7.1.7 to a higher version can result in some operation to fail. Workaround: After the firmware update, re-enroll the Nymi Band.
LC-848	Issue: Lock Control unlock through NFC tap can fail is the terminal does not have connection to NES. Workaround: Unlock the terminal by tapping Nymi Band on the Bluetooth Adapter. Alternatively ensure the terminal has connection to NES.

Table 8: Known Issues in CWP 1.14.1

Issue Number	Description
NEM-3009 NEM-3052	Issue: Users who belong to lots of Active Directory Groups (AD) or groups with long group names can experience slow response in Evidian, Evidian crashing, or NES admin console authentication failures.
	Workaround: Reduce the number of AD groups or length of AD group names for users with issues with NES authentication.
SDK5-2730	Issue: Nymi Runtime installation can fail in non-English operating systems.
	Workaround: Install Nymi Runtime on English Operating system ensure the windows built-in accounts are in English, e.g. NT AUTHORITY\Authenticated Users
SDK5-2657	Issue: Nymi Runtime installation stability issue where an installation can fail
	Workaround: Re-running the Runtime installer can address the issue
CWP-2750	Issue: Updating firmware from a version below 4.7.1.7 to a higher version can result in some operation to fail. Workaround: After the firmware update, re-enroll the Nymi Band.



Table 9: Resolved Issues in CWP 1.14.1

Issue Number	Description
LC-851	Lock Control shows sensitive user information in debug logs
NEM-3035	Incorrect user can be logged in NES audit data
NEM-3037	Incorrect timestamp can be logged in NES database

Table 10: Resolved Issues in CWP 1.14.0

Issue Number	Description
NF-4049	Issue: Nymi Band cannot work with the following devices: • Zebra ET80 tablet
	 Getac F110 (G6) tablet IDTronic NEO 2 desktop reader

Table 11: Known Issues in CWP 1.13.0

Issue Number	Description
SDK5-2691	Issue: When using BLE tap while the band is already near the reader when app is opened, tap doesn't register sometimes Workaround: Move band away from reader and tap again

Table 12: Known Issues in CWP 1.9.0

|--|



NEM-2936	Issue: When installing NES, the installer shows a warning in "SelectedSiteBinding" the remote server reporting an error (403): forbidden Workaround: This warning can be ignored. The NES install will proceed as expected.
NEM-2934	Issue: when creating a new Individual User Policy in NES, the Enhanced Fingerprint Security option is not shown and is only shown when the Individual User Policy is saved. Workaround: When creating an Individual User Policy, it will have the same Enhanced Fingerprint Security setting as the active group policy. After saving an Individual User Policy, always verify the Enhanced Fingerprint Security option.

Table 13: Known Issues in CWP 1.7.0

Issue Number	Description
SDK5-2437	Issue: On remote clients with NAPI DLL integration, the NBE reports connection issue with the remote client use multiple Network Interface Cards to access network Workaround: Ensure the same network interface is used when connecting to Nymi Agent and the NEA from a remote client

Table 14: Resolved Issues in CWP 1.6.1

Issue Number	Description
CWP-2726	Issue : The fix for NF-3977 creates an error if an L1 certificate is not found during Nymi Band enrollment.

Table 15: Known Issues in CWP 1.6.1

Issue Number	Description



NEM-2885	Issue: The silent installer uses a configuration file for settings. This release adds new configuration items to the file which must be present before the installer will run correctly. Workaround: The product documentation shows administrators what settings are required.
CWP-2724	Issue : If a user that brings the Nymi Band very close to the Bluetooth Adapter and transitions it on/off body, an BLE-tap will not be registered. Workaround: The issue is fixed moving the Nymi Band away from the Bluetooth Adapter.

Table 16: Resolved Issues in CWP 1.3.6

Issue Number	Description
NF-3977	Issue: NEA cert cache full prevents establishment of BLE secure sessions

Table 17: Resolved Issues in CWP 1.3.4

Issue Number	Description
NEM-2834	Issue: Upgrading issue when NES is not installed on C: drive
NEM-2835	Issue: NBA packages with older version of .NET framework

Table 18: Known Issues in CWP 1.3.3

Issue Number	Description
SDK5-2044	Issue : When two Nymi Bands simultaneously request create_symmetric_key, the operation ends in error for one of the requests Workaround: Retry the create_symmetric_key request



Table 19: Resolved Issues in CWP 1.3.3

Issue Number	Description
NEM-2818	Issue: Slow device authentication token enrollment
NEM-2826	Issue : Enrollment cannot succeed in a mixed Evidian and CWP only environment

Table 20: Known Issues in CWP 1.3.1

Issue Number	Description
SDK5-2043	Issue: Nymi Bluetooth Endpoint can crash after a long period where no Nymi Band is present. Workaround: Use SDK build 5.11.0+8-8 on non-iGel thin client environment

Table 21: Known Issues in CWP 1.3

The following section lists known issues as of the CWP 1.3 release.

Issue Number	Description
SDK5-1955	Issue: Silent installation of SDK does not install Bluegiga driver. Workaround: Run the standalone Bluegiga driver installer included in the SDK release package.
NEM-2803	Issue: Authentication related settings changes to the new default settings after upgrading to CWP 1.3.0. Workaround: Verify the group policy settings are desirable after upgrading to CWP 1.3.0.
NEM-2760	Issue: In the <i>Search</i> window, if you search with the none (group policy), not all users appear. Workaround: None.



	The Search results window only displays users that are in the NES database. Users appear in the NES database when an administrator has searched for them and viewed their properties or when a user has been enrolled to Nymi Band.
DOC-739	Issue: Not all CWP uses cases support multi-domain configurations. Workaround: None. Web Attestation and the Contact Tracing Dashboard use cases require user accounts to reside in the same domain as the infrastructure.

Table 22: Known Issues in CWP 1.2.1

The following section lists known issues as of the CWP 1.2.1 release.

Issue Number	Description
SDK5-1880	Issue: The Lock Control may not function properly through a remote session if the Window or Windows Server is not installed on C:\ drive Workaround: Make sure the Windows and Windows Server is installed on C:\ drive.
CWP-2095	Issue: When cache expiry settings are changed by an administrator, settings will take effect after the current expiry period if over. If an administrator checks the settings within the cache expiry time, they will appear unchanged. Workaround: Administrator should wait for the change to be implemented, typically 5 minutes, and the system will recover itself; or disable cache.

Table 23: Known Issues in CWP 1.2.0

The following section lists known issues as of the CWP 1.2.0 release.

Issue Number	Description
CWP-1931	Issue : When the user is signed into Health Check App across multiple device or in multiple browsers. Signing out in one session does not automatedly sign out all the other sessions.



	Workaround : Ensure the user signs out across all devices or close all browsers.
CWP-2018	Issue: The contact tracing information for a Nymi Band cannot be displayed when the Nymi Band is deleted in NES Workaround: First look up the MAC address of the deleted Nymi Band from the NES database, Nymi Band audit record. Then in the CT database, look up the contact events registered to that MAC address.
DCS-253	Issue : When viewed on certain browsers, the Contact Tracing Dashboard's Most Contact Employees graph does not zoom properly. Workaround : Return the browser to 100% zoom.
LC-797	 Issue: Unlocking the PC by NFC tap fails if the network connection to NES is unavailable. Workaround: Unlocking the PC by typing in username then hit enter key or by tapping the Nymi Band on the Bluetooth adapter (if BLE tap is enabled).
LC-827	Issue: The Lock Control does not contain the same SDK as the SDK released in CWP 1.2.0. The functionality of the Lock Control is not impacted. When updating from an earlier version, the SDK might not be automatically updated. Workaround: For new install or update, first install the Nymi SDK, then run the Lock Control installer.
NEM-2738	Issue: When updating the NES, at the Review Settings tab the installer may give a database login error. Workaround: Navigate to the Database tab and click the Test button. Then go back to Review Settings tab and click Test.
NEM-2744	Issue: The NES command prompt install tool fails when encryption is set to "None". Workaround: Deploy or update NES either use NES installer executable or the NES auto deploy script.



NEM-2546	Issue: When the user selects the Contact Support option from the Lock Control tray icon, a zip file of logs is generated but the location of the zip is not provided. Workaround: See the documentation for the location of the zip file.
NEM-2747	Issue: When updating the NBA to CWP 1.2.0, the installer does automatically update the SDK to the latest version. Without updating the SDK, user might encounter errors during enrollment. Workaround: Before upgrading the NBA, uninstall SDK that exists on the terminal.
SKD5-1803	Issue : Nymi runtime fails to install when installing to a non-default location. Workaround : Install the Nymi runtime at its default location: "C:\Program Files\Nymi"
SDK5-1839	Issue: Occasionally, CWP data is not retrieved by the edge agent while the Nymi Band is on charger. Workaround: The data will be retrieved when the Nymi Band is authenticated.
SDK5-1854 SDK5-1855	Issue: nbed cannot be upgraded or uninstalled from some models of thin clients. Workaround: Uninstall the nbed by reset the thin client. To upgrade the nbed, reset the thin client to a standard image and then install the newer version of nbed.

Table 24: Known Issues in CWP 1.1.x

The following known issues were reported in the CWP 1.1.x releases.

Issue Number	Description
DCS-260	Issue: log4j CVE-2021-44228 vulnerability
CWP-1157	Issue : If multiple Nymi Bands are placed on the charger simultaneously, the Contact Tracing Collection Agent (CTCA) may not retrieve the contract events from all the Nymi Bands.



Issue Number	Description
	Workaround : Take the Nymi band off the charger and the contact events will be retrieved by CTCA.
CWP-1081	Issue : If a user re-enrolls to a different Nymi Band, then any new contact data they collect will not show up for 24 hours in the dashboard. Workaround : Wait 24 hours for the data to update, or restart the CTCA.
CWP-1059	Issue : On the Contact Tracing dashboard, when searching for contact events by contact date, not all events may be returned for a specified day. Workaround : Add one day to the end of the date range specified in order to ensure that all data is returned.
CWP-1024, CWP-1012	Issue: In a multi-domain environment, the Contact Tracing dashboard only shows data from users in one domain. Workaround: Ensure that all users of the Contact Tracing feature are in the same domain.
CWP-1017	Issue: The Contact Tracing Collection Agent (CTCA) may take a long time to initialize the API. This is a benign issue as no data is lost.
CWP-1015	Issue: Multi-instance functionality for CTCA is not currently supported. If multiple instances of the CTCA are started, errors will occur and only one of the instances will function correctly.
CWP-1014	Issue: The Contact Tracing dashboard label for Contact Time, erroneously indicates that time is shown in UTC time zone. The time is shown is the local time of the web browser. This is a cosmetic issue that does not affect data.
CWP-1008	Issue: The format of the login name for the Contact Tracing dashboard is different from the format required by other Nymi product logins. Workaround : Ensure the login name is entered in the appropriate format: <usename>@example.domain.name</usename>



Issue Number	Description
CWP-1004	Issue: There is no input validation on user-specified queries for the Employee Timeline graph on the Contact Tracing dashboard. If an invalid query is entered, a blank graph is returned.
CWP-1000	Issue: On the Contact Tracing dashboard, the Update button for the Most Contacted Employee Details does not update the view. Workaround : Refresh the page to update the view.
CWP-926	Issue: The contact tracing dashboard does not indicate when the display is blank because there is no data in the database. This is a cosmetic issue and does not affect functionality.
CWP-691	Issue: Spurious warning messages about <i>ctca.properties</i> appear in the log when the configuration is correct. These warnings can be safely ignored. (This issue is only applicable for CWP 1.1.x)
CWP-570	Issue: On the Contact Tracing dashboard, the list of user contact events in the User Timeline is not paginated. Workaround: If too many results are returned, filter the search query to narrow the results.
CWP-569	Issue: On the Contact Tracing dashboard, the axis labels for Unique Contact Count stack on top of each other, making the text illegible. This is a cosmetic issue that does not affect the data.
NEM-2660	Issue: On Windows Server 2019, the SQL Express 2012 installer included in the NES installer may fail. Workaround: Install SQL Express 2017 in Basic mode before running the NES installer on Windows Server 2019.
NEM-2651	Issue: The NesSupportTool.exe is not able to extract and create a log zip file on Windows Server 2019.
NEM-2632	Issue: The .ninst file generated by NES is not self-documented. Contact Nymi Support for any .ninst file related questions.



Issue Number	Description
NEM-2553	Issue: Running the NES install.exe program for a second time causes a disabled NES Installer Maintenance dialog to appear. Workaround: None. This dialog does not require user intervention.
NEM-2270, NEM02280, NEM-2296	Issue: In some cases, after logging in to the NES Admin Console, the console page does not show that login succeeded. Workaround: Navigate to another page to confirm that login was successful.
NEM-1750	Issue: Any interruption in network connectivity during enrollment causes the system to become out of synch. Workaround: If network connectivity is lost during enrollment, perform a Delete User Data operation on the Nymi Band, disconnect the device from the user in the NES Admin Console, and restart enrollment.
NPM-363	Issue: By design, the Nymi Band firmware will not record a Proximity Event during the time that the Collection Agent is connected to download Proximity Events. In some rare cases, this can lead to a missed Contact Event.
SDK5-1729	Issue: While using Lock Control, i f a user moves their Nymi Band within 10cm of the BLE adapter, a login or unlock will occur even if that was not the user's intent. For example, this may occur if a user is reaching past the adapter to plug in a charger or access a USB hub. This is a benign issue and does not affect the behaviour of the system.
LC-785	Issue: When a user without an active Nymi Band registered in NES attempts an NFC tap to unlock or login, no error message is shown. This is a benign issue as the NFC tap is expected to fail when the Nymi Band is deactivated in NES.
NF-3748	Issue: In some rare instances, users may experience consecutive authentication failures due to the ECG measurement during Liveness Detection. Workaround: If required, Liveness Detection can be disabled. See NF-3733 for important considerations before using this workaround.



Issue Number	Description
NF-3745	Issue: The fingerprint sensor does not respond to the user placing their finger on the sensor. Authentication times out. Workaround : In this scenario, authentication failure now occurs quickly, and the user can retry authentication with a high chance of success.
NF-3741	Issue: In some cases, the firmware update may take longer than 300 seconds.
NF-3739	Issue: In some cases, the firmware updater program may not make use of all available BLE adapters. Workaround: If this issue occurs, stop and restart the updater.
NF-3738	Issue: In some rare instances, the fingerprint sensor may not respond while a user is attempting to register their fingerprint template. Workaround: Remove the Nymi Band from the wrist. Put the Nymi Band back on and restart the enrollment process.
NF-3733	Issue: When Liveness Detection is disabled in the NES Policy, it is possible for users to authenticate the Nymi Band on objects other than a human body if the correct fingerprint is provided. This is a known and expected side effect of disabling Liveness Detection. Workaround: Liveness Detection should be disabled only in environments where users are having difficulty authenticating due to liveness and no other remedy has resolved their issue.
NF-3724	Issue: In some rare cases, when using the firmware updater to update the firmware on a Nymi Band that is in Recovery mode, the update may fail on the first attempt. Workaround: No user intervention is required. The updater continues to retry the update until it is successful.
NF-3694, NF-3693, NF-3687	Issue: In some cases, when using the Nymi Band as a FIDO2 security key to sign into a Windows PC, the user may have to hold their Nymi Band over the NFC reader for up to 400ms. If this issue occurs, a full authentication may take up to 2000ms.



Table 25: Known Issues in NEE 3.3.0

The following known issues were reported in the NEE 3.3.0 release.

Issue Number	Description
NEM-2643	Issue: If the Nymi Band Application loses the network connection or if the app is closed during the fingerprint enrollment process, the Nymi Band and the application will become desynchronized, and enrollment is interrupted. Workaround: If this issue is encountered, the user must Delete User Data and start the enrollment process again.
NEM-2453	Issue: When upgrading NES from NEE 2.6.X to NEE 3.3.0, if the NES Admin Console is left open in a browser page, there can be deprecation in functionality. The logout button will not work. Workaround: Before performing an upgrade of NES, close all browsers with the NES Admin Console open.

Table 26: Known Issues for NEE 3.2.1

The following known issues were reported in the NEE 3.2.1 release.

Issue Number	Description
SOL-365	Issue : During the import of the <i>fullchain.p12</i> file, no keys are found for the certificate during the NES installation. While <i>certlm.msc</i> displays a private key icon next to the NES L2 certificate, Windows is not able to access the private key. This results in a failure on the NES diagnostics page indicating that there was an error generating test certificates.
	Workaround : Delete the entire certificate chain and then re-import the fullchain.p12 (right click - import PFX) resulting in the cert chain AND key being successfully imported. If the IIS application pool identity used by NES is not "LOCAL SYSTEM", then move the NES L2 certificate to the Intermediate CA certificate store, and run "iisreset".



Issue Number	Description
NEM-2302	Issue : Previously configured database logins are not saved in the generated .ninst file when loaded from a previous installation.
	Workaround : To generate a complete .ninst file, Export Settings immediately after completing a fresh installation of NES.
NEM-2295	Issue : NES does not have sufficient Application Pool identity permissions to support the infrastructure (NEA certificate generation, look-ups, etc.).
	Workaround : Change the Application Pool identity setting to LocalSystem.
NEM-2249	Issue : In the NES GUI installer, the user is unable to edit Database login details after initial entry of details.
	Workaround : Use the original database user details entered for the new user/auditor, or close and restart the NES installer.
NEM-2439	Issue: Completing a NES installation with a specific user account specified for the Application Pool identity, where the user account which does not have Database privileges, results in database errors when running tests on the database page in the NES installer.
	Workaround: If a NES installation is completed by a user who does not have Database permissions, complete the installation without running tests on the Database page of the installer.
SDK5-1618	Issue : When upgrading the Nymi runtime from NEE 2.6 to NEE 3.2, the Nymi Websocket API stops working.
	Resolution : Replace the original nymi_agent.toml file with the nymi_agent.toml file from the NEE 3.2.1 package.
NEM-1954	Issue : To configure hardening on NES, configure the NES to use LocalSystem identity from the Application Pool Identity list. This can be changed on the IIS page in the NES installer.





Copyright © 2023 Nymi Inc. All rights reserved. Published in December 2023

Nymi Inc. (Nymi) believes the information in this document is accurate as of its publication date. The information is subject to change without notice.

The information in this document is provided as-is and Nymi makes no representations or warranties of any kind. This document does not provide you with any legal rights to any intellectual property in any Nymi product. You may copy and use this document for your referential purposes.

This software or hardware is developed for general use in a variety of industries and Nymi assumes no liability as a result of their use or application. Nymi, Nymi Band, and other trademarks are the property of Nymi Inc. Other trademarks may be the property of their respective owners.

Published in Canada. Nymi Inc. Toronto, Ontario www.nymi.com