

Nymi Connected Worker Platform Release Notes

CWP 1.3.1

2022-October-6 v2.0



Contents

Contents	2
Table 1: Revision History	3
Nymi Connected Worker Platform 1.3.1	4
Nymi Connected Worker Platform components	5
Nymi Documentation Package	5
NFC Reader Support	6
New In This Release	6
iGEL Stability Improvement	6
NES Bug Fixes	6
Backwards Compatibility	7
Table 2: Backwards Compatibility Table	7
Upgrading to CWP 1.3.x	8
Table 3: Upgradability Table	8
Known Issues and Limitations	8
Table 4: Resolved Issues in CWP 1.3.1	8
Table 5: Known Issues in CWP 1.3	9
Table 6: Known Issues in CWP 1.2.1	10
Table 7: Known Issues in CWP 1.2.0	10
Table 8: Known Issues in CWP 1.1.x	12
Table 9: Known Issues in NEE 3.3.0	16
Table 10: Known Issues for NEE 3.2.1	16
Appendix 1: NFC Readers Tested for CWP 1.3.0	19
Table 11: NFC Readers	19



Table 1: Revision History

Version	Date	Revision History
01	June 13, 2022	First release of document
02	October 6, 2022	Amended the release package to address issue uncovered post release - Adding CWP 1.3.0 SDK build to the release package - Restricting the usage of the SDK build from the original release - Adding a defect to the known defect list



Amendment (2022-Oct-06)

The CWP 1.3.1 Release Note was published on June 13, 2022. An SDK related defect (<u>SDK5-2043</u>) was discovered after the release. To address this issue and allow the CWP continued to be deployed, a new version of the CWP 1.3.1 release memo is created with the following amendment:

- Adding SDK build 5.11.0+8-8 to the CWP 1.3.1 release package. This SDK build is suitable to be used for all use cases **except** on iGel thin clients.
- Restricting the use of SDK build 5.11.1+9-9 to the iGel thin clients.

No additional QA validation and UAT is required for the amendment. SDK build 5.11.0+8-8 is part of the CWP 1.3.0 releases. It has gone through the Risk Level 0 validation process and deemed suitable for use in a GxP environment. Therefore, no further validation is required and CWP 1.3.1 maintains its Risk Level 0 status.

Finally, the fix to the SDK defect will be implemented in CWP 1.4.0 (SDK5-2040).

For clarity, all amended contents in this document are shown in **bold and underscore** font.



Nymi Connected Worker Platform 1.3.1

Nymi's Connected Worker Platform (CWP) connects people with technology through safe, simple, and secure solutions. The Connected Worker Platform supports numerous use cases and digital systems and combines point solutions into a single offering.

The goal of the Connected Worker Platform is to simplify the connection of workers to the digital space found in modern organizations. When the barriers to secure digital work are removed, workers can focus on what they do best.

The CWP 1.3.1 release is a patch to the CWP 1.3.0 release. The present release is suitable to be used in GxP environment.

Nymi Connected Worker Platform components

CWP 1.3.1 includes the following component versions:

- Nymi Band™ 3.0
- Firmware version of Nymi Band 3.0-4.2.9.5
- Nymi Band Application–4.0.2.3
- Nymi Lock Control-3.4.2.10
- Nymi Enterprise Server–4.2.1.7
- Nymi Enterprise Server Auto Deployment Scripts—1.2.4
- Nymi SDK
 - o For all platform (except on iGel): 5.11.0+8-8
 - o Restricted for iGel only: 5.11.1+9-9
- CWP backend components 1.2.1.12
- Nymi Data Exchange Service Edge Agent -1.1.0.2

Nymi Documentation Package

No new documentation is updated in CWP 1.3.1. For latest documentations visit the Nymi Support site.

- To access all the core documents, visit: https://support.nymi.com/hc/en-us/articles/6337039121940-Connected-Worker-Platform-1-3-Product-Documentation
- To access all the secondary documents, visit: https://support.nymi.com/hc/en-us/sections/360012100892-Supplementary-Product-Documentation



NFC Reader Support

NFC reader support is not tested under the CWP 1.3.1 release. For NFC readers supported in the previous CWP releases see Appendix 1.

New In This Release

iGEL Stability Improvement

Improve Nymi Bluetooth Endpoint stability on iGel thin clients. The NBE restarts automatically if it receives corrupted data from iGEL avoiding being stuck in a deadlock. The end user can continue use their Nymi Band after the NBE restart.

The iGel support is only available with SDK build 5.11.1+9-9

NES Bug Fixes

Fix defect associated with NES individual user policy and the NES automated deployment script.



Backwards Compatibility

Table 2: Backwards Compatibility Table

				Nymi Infrastructure								
			NEE 2.5	NEE 2.6	NEE 3.0	NEE 3.1	NEE 3.2	NEE 3.3	CWP 1.1.x	CWP 1.2.x	CWP 1.3.0	CWP 1.3.1
	Nymi Band 2.0	NEE 2.5	•	•								
Φ		NEE 2.6	•	•								
var		NEE 3.0			•							
Nymi Band Firmware		NEE 3.1	•	•		•						
	NEE 3.2	•	•			•	•					
	NEE 3.3	•	•			•	•					
	CWP 1.1.x							•				
	CWP 1.2								•	•	•	
Z		CWP 1.3								•	•	•
		CWP 1.3.1								•	•	•

Legend:

•	Compatible	Not compatible (empty box)



Upgrading to CWP 1.3.x

Table 3: Upgradability Table

Release versions	Upgradability
NEE 3.2.X to CWP 1.3.x	NES: - direct upgrade NBA: - direct upgrade
NEE 3.3.X to CWP 1.3.x	 can be upgraded after NES upgrade Firmware: direct upgrade re-enroll required after upgrade can be upgrade after NES and NBA upgrade
CWP 1.1.X to CWP 1.3.x CWP 1.2.X to CWP 1.3.x	NES: - direct upgrade NBA: - direct upgrade
	Firmware: - direct upgrade

The change implemented in CWP prevents Nymi Band running CWP 1.3.0 firmware to work properly with NEE 3.3.x SDK, specifically the Nymi Bluetooth Endpoint. To ensure the CWP function as expected, all CWP components have to be upgrade.

Known Issues and Limitations

Table 4: Resolved Issues in CWP 1.3.1

Issue Number	Description
NEM-2813	Issue: NES automated deployment script signing certificate expired



NEM-2812	Issue: NES shows error when user saves changes made to individual user policy
NEM-2552	Issue: NES installer shows incorrect page titles

Table 5: Known Issues in CWP 1.3.1

Issue Number	Description
SDK5-2043	Issue: Nymi Bluetooth Endpoint can crash after a long period where no Nymi Band is present. Workaround: Use SDK build 5.11.0+8-8 on non-iGel thin client environment

Table 6: Known Issues in CWP 1.3

The following section lists known issues as of the CWP 1.3 release.

Issue Number	Description
SDK5-1955	Issue: Silent installation of SDK does not install Bluegiga driver. Workaround: Run the standalone Bluegiga driver installer included in the SDK release package.
NEM-2803	Issue: Authentication related settings changes to the new default settings after upgrading to CWP 1.3.0. Workaround: Verify the group policy settings are desirable after upgrading to CWP 1.3.0.
NEM-2760	Issue: In the Search window, if you search with the none (group policy), not all users appear. Workaround: None. The Search results window only displays users that are in the NES database. Users appear in the NES database when an administrator has searched for them and viewed their properties or when a user has been enrolled to Nymi Band.



DOC-739	Issue: Not all CWP uses cases support multi-domain configurations.
	Workaround: None. Web Attestation and the Contact Tracing Dashboard use
	cases require user accounts to reside in the same domain as the infrastructure.

Table 7: Known Issues in CWP 1.2.1

The following section lists known issues as of the CWP 1.2.1 release.

Issue Number	Description
SDK5-1880	Issue: The Lock Control may not function properly through a remote session if the Window or Windows Server is not installed on C:\ drive Workaround: Make sure the Windows and Windows Server is installed on C:\ drive.
CWP-2095	Issue: When cache expiry settings are changed by an administrator, settings will take effect after the current expiry period if over. If an administrator checks the settings within the cache expiry time, they will appear unchanged. Workaround: Administrator should wait for the change to be implemented, typically 5 minutes, and the system will recover itself; or disable cache.

Table 8: Known Issues in CWP 1.2.0

The following section lists known issues as of the CWP 1.2.0 release.

Issue Number	Description
CWP-1931	Issue: When the user is signed into Health Check App across multiple device or in multiple browsers. Signing out in one session does not automatedly sign out all the other sessions. Workaround: Ensure the user signs out across all devices or close all browsers.
CWP-2018	Issue: The contact tracing information for a Nymi Band cannot be displayed when the Nymi Band is deleted in NES Workaround: First look up the MAC address of the deleted Nymi Band from the NES database, Nymi Band audit record. Then in the CT database, look up the contact events registered to that MAC address.



DCS-253	Issue: When viewed on certain browsers, the Contact Tracing Dashboard's Most Contact Employees graph does not zoom properly. Workaround: Return the browser to 100% zoom.	
LC-797	Issue: Unlocking the PC by NFC tap fails if the network connection to NES is unavailable. Workaround: Unlocking the PC by typing in username then hit enter key or by tapping the Nymi Band on the Bluetooth adapter (if BLE tap is enabled).	
LC-827	Issue: The Lock Control does not contain the same SDK as the SDK released in CWP 1.2.0. The functionality of the Lock Control is not impacted. When updating from an earlier version, the SDK might not be automatically updated. Workaround: For new install or update, first install the Nymi SDK, then run the Lock Control installer.	
NEM-2738	Issue: When updating the NES, at the Review Settings tab the installer may give a database login error. Workaround: Navigate to the Database tab and click the Test button. Then go back to Review Settings tab and click Test.	
NEM-2744	Issue: The NES command prompt install tool fails when encryption is set to "None". Workaround: Deploy or update NES either use NES installer executable or the NES auto deploy script.	
NEM-2546	Issue : When the user selects the Contact Support option from the Lock Control tray icon, a zip file of logs is generated but the location of the zip is not provided. Workaround : See the documentation for the location of the zip file.	
NEM-2747	Issue: When updating the NBA to CWP 1.2.0, the installer does automatically update the SDK to the latest version. Without updating the SDK, user might encounter errors during enrollment. Workaround: Before upgrading the NBA, uninstall SDK that exists on the terminal.	
SKD5-1803	Issue: Nymi runtime fails to install when installing to a non-default location. Workaround: Install the Nymi runtime at its default location: "C:\Program Files\Nymi"	



SDK5-1839	Issue: Occasionally, CWP data is not retrieved by the edge agent while the Nymi Band is on charger. Workaround: The data will be retrieved when the Nymi Band is authenticated.
SDK5-1854 SDK5-1855	Issue : nbed cannot be upgraded or uninstalled from some models of thin clients. Workaround : Uninstall the nbed by reset the thin client. To upgrade the nbed, reset the thin client to a standard image and then install the newer version of nbed.

Table 9: Known Issues in CWP 1.1.x

The following known issues were reported in the CWP 1.1.x releases.

Issue Number	Description	
DCS-260	Issue: log4j CVE-2021-44228 vulnerability	
CWP-1157	Issue : If multiple Nymi Bands are placed on the charger simultaneously, the Contact Tracing Collection Agent (CTCA) may not retrieve the contract events from all the Nymi Bands. Workaround : Take the Nymi band off the charger and the contact events will be retrieved by CTCA.	
CWP-1081	Issue: If a user re-enrolls to a different Nymi Band, then any new contact data they collect will not show up for 24 hours in the dashboard. Workaround: Wait 24 hours for the data to update, or restart the CTCA.	
CWP-1059	Issue : On the Contact Tracing dashboard, when searching for contact events by contact date, not all events may be returned for a specified day. Workaround : Add one day to the end of the date range specified in order to ensure that all data is returned.	
CWP-1024, CWP-1012	Issue: In a multi-domain environment, the Contact Tracing dashboard only shows data from users in one domain. Workaround: Ensure that all users of the Contact Tracing feature are in the same domain.	



Issue Number	Description	
CWP-1017	Issue: The Contact Tracing Collection Agent (CTCA) may take a long time to initialize the API. This is a benign issue as no data is lost.	
CWP-1015	Issue: Multi-instance functionality for CTCA is not currently supported. If multiple instances of the CTCA are started, errors will occur and only one of the instances will function correctly.	
CWP-1014	Issue: The Contact Tracing dashboard label for Contact Time, erroneously indicates that time is shown in UTC time zone. The time is shown is the local time of the web browser. This is a cosmetic issue that does not affect data.	
CWP-1008	Issue: The format of the login name for the Contact Tracing dashboard is different from the format required by other Nymi product logins. Workaround: Ensure the login name is entered in the appropriate format: <usename>@example.domain.name</usename>	
CWP-1004	Issue: There is no input validation on user-specified queries for the Employee Timeline graph on the Contact Tracing dashboard. If an invalid query is entered, a blank graph is returned.	
CWP-1000	Issue: On the Contact Tracing dashboard, the Update button for the Most Contacted Employee Details does not update the view. Workaround: Refresh the page to update the view.	
CWP-926	Issue: The contact tracing dashboard does not indicate when the display is blank because there is no data in the database. This is a cosmetic issue and does not affect functionality.	
CWP-691	Issue: Spurious warning messages about <i>ctca.properties</i> appear in the log when the configuration is correct. These warnings can be safely ignored. (This issue is only applicable for CWP 1.1.x)	
CWP-570	Issue: On the Contact Tracing dashboard, the list of user contact events in the User Timeline is not paginated.	



Issue Number	Description	
	Workaround : If too many results are returned, filter the search query to narrow the results.	
CWP-569	Issue: On the Contact Tracing dashboard, the axis labels for Unique Contact Count stack on top of each other, making the text illegible. This is a cosmetic issue that does not affect the data.	
NEM-2660	Issue: On Windows Server 2019, the SQL Express 2012 installer included in the NES installer may fail. Workaround: Install SQL Express 2017 in Basic mode before running the NES installer on Windows Server 2019.	
NEM-2651	Issue: The NesSupportTool.exe is not able to extract and create a log zip file on Windows Server 2019.	
NEM-2632	Issue: The .ninst file generated by NES is not self-documented. Contact Nymi Support for any .ninst file related questions.	
NEM-2553	Issue: Running the NES install.exe program for a second time causes a disabled NES Installer Maintenance dialog to appear. Workaround: None. This dialog does not require user intervention.	
NEM-2270, NEM02280, NEM-2296	Issue: In some cases, after logging in to the NES Admin Console, the console page does not show that login succeeded. Workaround: Navigate to another page to confirm that login was successful.	
NEM-1750	Issue: Any interruption in network connectivity during enrollment causes the system to become out of synch. Workaround: If network connectivity is lost during enrollment, perform a Delete User Data operation on the Nymi Band, disconnect the device from the user in the NES Admin Console, and restart enrollment.	
NPM-363	Issue: By design, the Nymi Band firmware will not record a Proximity Event during the time that the Collection Agent is connected to download Proximity Events. In some rare cases, this can lead to a missed Contact Event.	
SDK5-1729	Issue: While using Lock Control, i f a user moves their Nymi Band within 10cm of the BLE adapter, a login or unlock will occur even if that was not the user's intent.	



Issue Number	Description	
	For example, this may occur if a user is reaching past the adapter to plug in a charger or access a USB hub. This is a benign issue and does not affect the behaviour of the system.	
LC-785	Issue: When a user without an active Nymi Band registered in NES attempts an NFC tap to unlock or login, no error message is shown. This is a benign issue as the NFC tap is expected to fail when the Nymi Band is deactivated in NES.	
NF-3748	Issue: In some rare instances, users may experience consecutive authentication failures due to the ECG measurement during Liveness Detection. Workaround : If required, Liveness Detection can be disabled. See NF-3733 for important considerations before using this workaround.	
NF-3745	Issue: The fingerprint sensor does not respond to the user placing their finger on the sensor. Authentication times out. Workaround: In this scenario, authentication failure now occurs quickly, and the user can retry authentication with a high chance of success.	
NF-3741	Issue: In some cases, the firmware update may take longer than 300 seconds.	
NF-3739	Issue: In some cases, the firmware updater program may not make use of all available BLE adapters. Workaround: If this issue occurs, stop and restart the updater.	
NF-3738	Issue: In some rare instances, the fingerprint sensor may not respond while a user is attempting to register their fingerprint template. Workaround: Remove the Nymi Band from the wrist. Put the Nymi Band back on and restart the enrollment process.	
NF-3733	Issue: When Liveness Detection is disabled in the NES Policy, it is possible for users to authenticate the Nymi Band on objects other than a human body if the correct fingerprint is provided. This is a known and expected side effect of disabling Liveness Detection. Workaround: Liveness Detection should be disabled only in environments where users are having difficulty authenticating due to liveness and no other remedy has resolved their issue.	



Issue Number	Description
NF-3724	Issue: In some rare cases, when using the firmware updater to update the firmware on a Nymi Band that is in Recovery mode, the update may fail on the first attempt. Workaround: No user intervention is required. The updater continues to retry the update until it is successful.
NF-3694, NF-3693, NF-3687	Issue: In some cases, when using the Nymi Band as a FIDO2 security key to sign into a Windows PC, the user may have to hold their Nymi Band over the NFC reader for up to 400ms. If this issue occurs, a full authentication may take up to 2000ms.

Table 10: Known Issues in NEE 3.3.0

The following known issues were reported in the NEE 3.3.0 release.

Issue Number	Description	
NEM-2643	Issue: If the Nymi Band Application loses the network connection or if the app is closed during the fingerprint enrollment process, the Nymi Band and the application will become desynchronized, and enrollment is interrupted. Workaround: If this issue is encountered, the user must Delete User Data and start the enrollment process again.	
NEM-2453	Issue: When upgrading NES from NEE 2.6.X to NEE 3.3.0, if the NES Admin Console is left open in a browser page, there can be deprecation in functionality. The logout button will not work. Workaround: Before performing an upgrade of NES, close all browsers with the NES Admin Console open.	

Table 11: Known Issues for NEE 3.2.1

The following known issues were reported in the NEE 3.2.1 release.



Issue Number	Description
SOL-365	Issue : During the import of the <i>fullchain.p12</i> file, no keys are found for the certificate during the NES installation. While <i>certlm.msc</i> displays a private key icon next to the NES L2 certificate, Windows is not able to access the private key. This results in a failure on the NES diagnostics page indicating that there was an error generating test certificates.
	Workaround: Delete the entire certificate chain and then re-import the fullchain.p12 (right click - import PFX) resulting in the cert chain AND key being successfully imported. If the IIS application pool identity used by NES is not "LOCAL SYSTEM", then move the NES L2 certificate to the Intermediate CA certificate store, and run "iisreset".
NEM-2302	Issue : Previously configured database logins are not saved in the generated .ninst file when loaded from a previous installation.
	Workaround : To generate a complete .ninst file, Export Settings immediately after completing a fresh installation of NES.
NEM-2295	Issue : NES does not have sufficient Application Pool identity permissions to support the infrastructure (NEA certificate generation, look-ups, etc.).
	Workaround : Change the Application Pool identity setting to LocalSystem.
NEM-2249	Issue : In the NES GUI installer, the user is unable to edit Database login details after initial entry of details.
	Workaround : Use the original database user details entered for the new user/auditor, or close and restart the NES installer.
NEM-2439	Issue: Completing a NES installation with a specific user account specified for the Application Pool identity, where the user account which does not have Database privileges, results in database errors when running tests on the database page in the NES installer.



Issue Number	Description	
	Workaround: If a NES installation is completed by a user who does not have Database permissions, complete the installation without running tests on the Database page of the installer.	
SDK5-1618	Issue : When upgrading the Nymi runtime from NEE 2.6 to NEE 3.2, the Nymi Websocket API stops working.	
	Resolution : Replace the original nymi_agent.toml file with the nymi_agent.toml file from the NEE 3.2.1 package.	
NEM-1954	Issue : To configure hardening on NES, configure the NES to use LocalSystem identity from the Application Pool Identity list. This can be changed on the IIS page in the NES installer.	



Appendix 1: NFC Readers Tested for CWP 1.3.0

Nymi includes dedicated NFC reader compatibility testing as part of its release testing. The following table covers the specific NFC reader models tested for compatibility with CWP 1.3.0. Note that the level of ongoing testing is indicated as follows:

- 1. <u>Recommended Readers</u> best performance; testing planned with every CWP release going forward from CWP 1.3.0.
- 2. <u>Supported Readers</u> meet specific use cases but may not perform as well as a recommended reader; testing planned with every CWP release going forward from CWP 1.3.0.
- 3. <u>Verified Readers</u> tested against a minimum of one NEE or CWP release; additional testing may be required to support additional releases; will be tested as part of the customer upgrade process.

Table 12: NFC Readers

NFC Reader Model	Status
HID Omnikey 5022	Recommended
ACS ACR122U	Verified with CWP 1.3.0
Systec CONNECT BOX	Verified with NEE 3.3.0
Elatec TWN4 LEGIC NFC USB	Verified with CWP 1.3.0
HID Omnikey 5127CK Mini	Verified with NEE 3.2.0
ACS ACR1252U	Verified with NEE 3.2.0
Identiv CLOUD/uTrust 3700 F	Verified with NEE 3.2.0
RFIdeas WAVE ID Nano SDK 13.56MHz CSN Black Vertical USB Reade	Verified with CWP 1.3.0



Copyright © 2022 Nymi Inc. All rights reserved. Published in December 2022

Nymi Inc. (Nymi) believes the information in this document is accurate as of its publication date. The information is subject to change without notice.

The information in this document is provided as-is and Nymi makes no representations or warranties of any kind. This document does not provide you with any legal rights to any intellectual property in any Nymi product. You may copy and use this document for your referential purposes.

This software or hardware is developed for general use in a variety of industries and Nymi assumes no liability as a result of their use or application. Nymi, Nymi Band, and other trademarks are the property of Nymi Inc. Other trademarks may be the property of their respective owners.

Published in Canada.
Nymi Inc.
Toronto, Ontario
www.nymi.com